




Application Tooling Specification Sheet

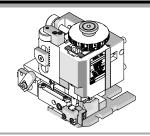

Order No. 63901-3300

FEATURES


- Directly adapts to most automatic wire processing machines
- Quick punch removal with the push of a button for fast and easy tooling change
- Applicator designed to industry standard mounting and shut height 135.80mm (5.346")
- Quick set-up time; plus the crimp height, track and feed adjustments can be set without removing the applicator from the press
- Fine adjustment allows users to achieve target with little effort by adjusting in increments of .015mm (.0006") for conductor crimp height and .063mm (.0025") for insulation height
- Independent adjustment rings allow users to quickly adjust the conductor or insulation crimp height without affecting each other

SCOPE

<u>Products</u>: Sabre[™] Male Flat Blade Crimp Terminal, 18-20 AWG, UL1015 wire.

Terminal Series No.	Terminal Order No.		Wire Size			Insulation	Strip Length			
					IPC/WHMA-A620 (1)				Terminal (2)	
Series No.			AWG	mm²	mm	ln.	mm	ln.	mm	ln.
43178	43178-4001	43178-4002	18-20	0.50-0.80	2.50-2.85	.098112	2.50-2.85	.098112	3.96-5.54	.156218

- 1. To achieve optimum IPC-A620 insulation crimps, use this insulation OD range.
- 2. Overall insulation OD specification for terminal.

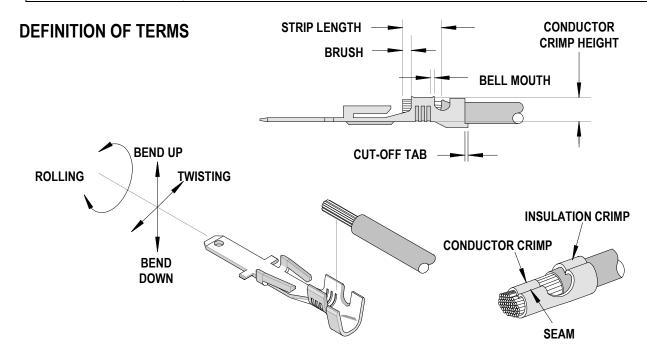

Doc No: ATS-639013300 Release Date: 10-21-09 Revision: F Revision Date: 01-30-14

CRIMP SPECIFICATION

Terminal Series No.	Bell n	nouth	Cut-off Tak	Maximum	Conductor Brush	
reminal Selles No.	mm	ln.	mm	ln.	mm	ln.
43178	0.25-1.00	.010039	0.50	.019	1.50	.059

	Bend up Bend down		Twist Roll		Punch Width (Ref)				Seam
Terminal Series No.					Conductor		Insulation		
	Deg	Degree		Degree		In	mm	ln	Seam shall not be open
43178	3	3	4	8	2.30	.090	3.60	.142	and no wire allowed out of the crimping area

After crimping, the conductor profile should measure the following.

Terminal Series No.	Wire	Size	Crimp	Height	Pull Force Minimum		
Terminal Series No.	AWG	AWG mm ²		ln.	N	Lb.	
43178	18	0.80	1.52-1.60	.060063	88.9	20.0	
43170	20	0.50	1.42-1.50	.056059	57.9	13.0	

Tool Qualification Notes:


- 1. Pull Force should be measured with no influence from the insulation crimp.
- 2. The above specifications are guidelines to an optimum crimp.

UNCONTROLLED COPY Doc No: ATS-639013300 Page 2 of 5 Revision: F Revision Date: 01-30-14

PARTS LIST

	FineAdjust Applicator 63901-3300								
Item	Order No Engineering No. Description								
Perishable Tooling									
	63901-3370	63901-3370	Tool Kit (All "Y" Items)	REF					
1	63444-2309	63444-2309	Conductor Punch	1 Y					
2	63445-2337	63445-2337	Conductor Anvil	1 Y					
3	63446-3613	63446-3613	Insulation Punch	1 Y					
4	63445-3622	63445-3622	Insulation Anvil	1 Y					
5	63443-0037	63443-0037	Front Cut-Off Plunger	1 Y					
6	63443-0038	63443-0038	Front Plunger Retainer	1 Y					
		Other	Components						
7	11-18-4083	60707-8	Feed Guide	1					
8	63443-0009	63443-0009	Front Scrap Chute	1					
9	63443-0024	63443-0024	Key	1					
10	63443-0090	63443-0090	Wire Stop	1					
11	63443-1712	63443-1712	Height Spacer	1					
12	63443-2215	63443-2215	Coarse Spacer (15.00mm)	1					
13	63443-2301	63443-2301	Spacer (3.05mm)	1					
14	63443-2801	63443-2801	Front Plunger Striker	1					
15	63443-2915	63443-2915	Wire Hold Down Plunger	1					
16	63443-6121	63443-6121	Rear Cover	1					
17	63600-1057	63600-1057	Wire Hold Down Spring	1					
18	63700-0539	63700-0539	Compression Spring	1					
			Frame						
19	63800-4901	63800-4901	Тор	1					
20	63801-3281	63801-3281	Base	1					
21	63801-4650	63801-4650	Track	1					
		H	lardware						
22	N/A	N/A	M3 by 6 Long SHCS	2**					
23	N/A	N/A	M3 by 6 Long FHCS	1**					
24	N/A	N/A	M4 by 6 Long SHCS	2**					
25	N/A	N/A	M4 by 12 Long BHCS	2**					
26	N/A	N/A	M4 by 50 Long SHCS	2**					
27	N/A	N/A	M5 by 12 Lg SHCS	1**					
28	N/A	N/A	#10-32 by 3/8"Long Flat Point SSS	1**					
29	N/A	N/A	#10-32 Hex Jam Nut	1**					
**	** Available from an industrial supply company such as MSC (1-800-645-7270).								

UNCONTROLLED COPY Doc No: ATS-639013300 Release Date: 10-21-09 Page 3 of 5 Revision: F

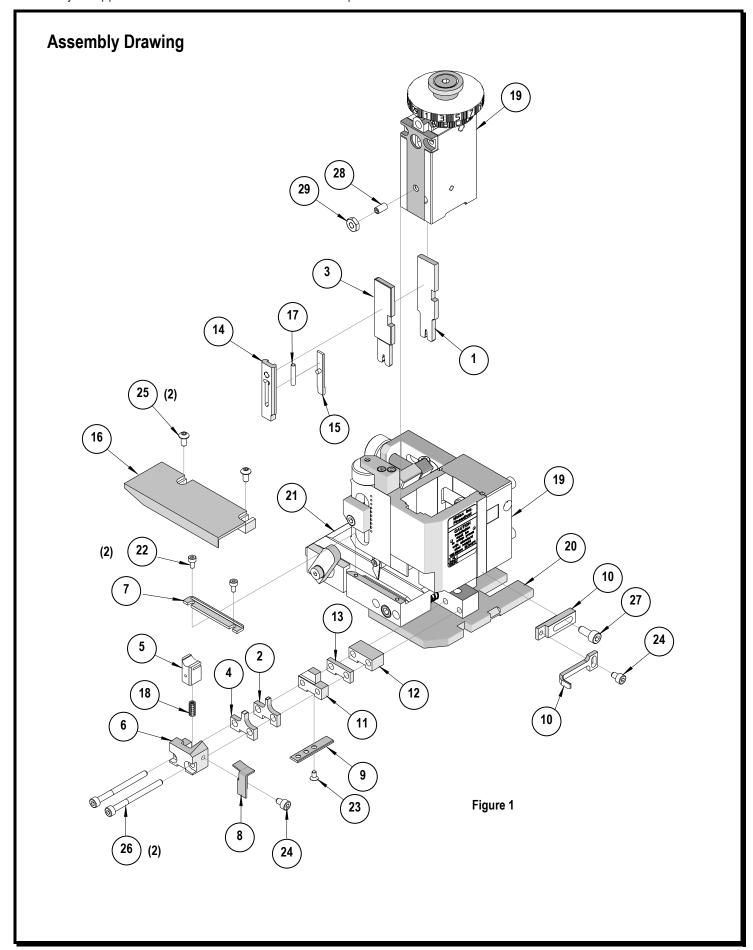

Doc No: ATS-639013300 Revision: F Release Date: 10-21-09 Revision Date: 01-30-14

NOTES

- 1. Molex recommends an extra perishable tooling kit be maintained at your facility.
- 2. Verify tooling alignment by manually cycling the press and Applicator before crimping under power. Check that all screws are tight.
- 3. Slugs, Terminals, Dirt and Oil should be kept clear of work area.
- 4. Wear safety glasses at all times.
- 5. For recommended maintenance refer to the FineAdjust Manual.

CAUTION: This applicator should only be used in a press with a shut height of 135.8mm (5.346"). Tooling damage could result at a lower setting.

CAUTION: To prevent injury never operate this Applicator without the guards supplied with the press or wire-processing machine in place. Reference the press or wire processing manufacturer's instruction manual.

CAUTION: Molex crimp specifications are valid only when used with Molex terminals, applicators and tooling.

Visit our Web site at http://www.molex.com

Doc No: ATS-639013300 Release Date: 10-21-09 **UNCONTROLLED COPY** Page 5 of 5 Revision: F Revision Date: 01-30-14